

# SIDE SENSOR RELOCATION APPLICATIONS



## SIDE SENSOR RELOCATION APPLICATION CHART

For select newer pickup models, Tommy Gate now offers optional Side Sensor Relocation Kits compatible with G2 Series liftgates. The optional kits install on the side of the liftgate, repositioning the vehicle side-facing sensors\*. These kits require a rear camera and sensor bar, sold separately.


*\*Component functionality must be verified by installer*

MAKE	YEAR	MODEL	FEATURE KEYWORDS <sup>1</sup>	VISUAL CLUE	PAINTED KIT NUMBER	GALVANIZED KIT NUMBER	INSTRUCTION SET
CHEVY/ GMC	2019-2025	Silverado/Sierra 1500 <sup>2</sup>	Rear Cross-Traffic Alert, Side Blind Zone Alert	Indicator Lights in Side Mirrors	017956	Use Painted Kit	95360
	2020-2025	Silverado/Sierra 2500/3500					
	2023-2025	Colorado/Canyon	Rear Cross-Traffic Alert, Side Blind Zone Alert	Indicator Lights in Side Mirrors	018085	Use Painted Kit	95369
FORD	2024-2025	Ranger	Active Park Assist (Not Reverse Park Aid)	Six (6) parking sensors in rear bumper	018139	Use Painted Kit	95270
RAM	2019-2024	1500 <sup>2</sup>	Parallel and Perpendicular Park Assist (Not the regular Park Assist)	Six (6) parking sensors in rear bumper	016845	016846	95314
	2025	1500	Rear Cross-Traffic Alert, Side Blind Zone Alert	Indicator Lights in Side Mirrors <sup>3</sup>	018444	Use Painted Kit	95378
	2019-2024	1500 Classic	N/A	N/A	N/A	N/A	N/A
	2019-2024	2500/3500 SRW	N/A	N/A	N/A	N/A	N/A
	2019-2024	3500 DRW	Parking Sensors, Rear Park Assist	Six (6) parking sensors in rear bumper	016845	016846	95314
NISSAN	2022-2025	Frontier	Rear Cross Traffic Alert, Blind Spot Warning	Indicator Lights in Side Mirrors	017675	017770	95347
	2017-2024	Titan					

*N/A = Not Applicable*

**IMPORTANT** • Vehicles with the listed feature(s) require the listed side sensor relocation kit. Otherwise, only the Rear Camera and Sensor Bar Kit is needed.

- NOTES**
1. Feature names change over time. Look for these keywords to decide whether side sensors are present if only the window sticker or order information is available.
  2. Excludes “older” body styles that were sold under a similar model name in the same years:
    - 2019 Chevrolet Silverado 1500 LD
    - 2019 GMC Sierra 1500 Limited
    - 2019-2024 Ram 1500 Classic
  3. Not compatible if the truck has six (6) parking sensors in the rear bumper AND has indicator lights in side mirrors.

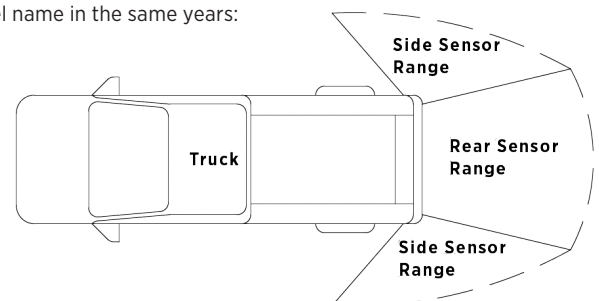

Tommy Gate® liftgates are industrial products for material handling only and are not to be used as personnel or wheelchair lifts. For safe handling and operating instructions, visit [www.tommygate.com](http://www.tommygate.com).